

Kodak i1100 Series Scanners Windows Drivers Release Notes

Version CD 3.01 and Firmware 1.32 or 1.36 Summary

Purpose of Release: This is a CPE release of drivers for the Kodak i1100 (i1150, i1190, i1190E, i1180) Scanner family.

Note: The drivers only file, InstallSoftware_i11xx_v3.1.exe, does not include user guides or the required Microsoft .net framework files. This file can be used as the initial installation on a computer as long as .net framework has been installed. Window 7,8.1 and 10 includes as standard the required .net framework.

The ISO image is required for silent driver installation, advanced (selectable) installation or first time installation on a Windows XP or Vista computer.

Instructions for installing drivers using the ISO file:

For Windows 8.1 and 10 OS, mount the ISO file as a drive. (right click on the ISO file and select Mount)

For Windows 7 OS, either the ISO file has to be mounted as a drive or the ISO contents extracted to a folder using a 3rd party software tool. Software Tool providers (tools have not been tested and are not supported by the Kodak Alaris team, customers have reported that (7-zip, winrar, winiso) offer such capability.

Date:	February 14, 2018
CD Version:	3.01
Firmware	1.36 (separate file, not part of CD) for i1150/i1190
Firmware	1.32 (separate file, not part of CD) for i1180/i1190E
Twain:	16.1
Driver.dll:	5.1
Twaingui:	8.12
Hippo.dll:	52.35
Device.dll:	5.0
DeviceManager.dll:	1.21
ISIS driver:	1.1.11609.30001
Scan Validation	14.19
Smart Touch App	No longer on installation media

Change Requests Implemented:

1. None

Driver Issues Fixed:

1. DIAS-1430, DIAS-1452 – Twain Driver will not connect with Windows 10 Creator v1709
2. CPSOLSTS-237 –Smart Touch buttons do not work with Windows 10 Creator v1709
3. DIAS-1383 – Scanner freezes after scanning one page

Kodak i1100 Series Scanners Windows Drivers Release Notes

Firmware Issues Fixed:

1. DIAS-1362 – Add support for a custom alteration such that when USB Vbus is removed the scanner will power off. .

Known Issues:

1. DIAS-1508 – SVT service license keys will be deleted when CD 3.1 is installed on a Windows 10 computer.
 - a. Obtain a new SVT service key for the computer.
2. PR 25176: CD 2.04 and higher will not install on “Server 2008-R2” and “Server 2012-R2”
 - a. Workaround
 - i. .NET Framework 3.5 or higher must be installed
 - ii. Desktop Experience must be installed
 - iii. Must be logged in as administrator
 - iv. Must right click on set_up.exe and use can install via Run as administrator

Kodak i1100 Series Scanners Windows Drivers Release Notes

Version CD 2.26 Summary

Purpose of Release: This is a CPE release of drivers for the Kodak i1150 Scanner.

Note: When installing a Kodak i1150 Scanner on a host PC for the first time the Full Install CD (shipped with the scanner) must be used. The InstallSoftware_v2.xx.exe may be used to update a host PC that used an Install CD Version 1.xx for its first install.

Instructions for installing drivers using the ISO file:

For Windows 8.1 and 10 OS, mount the ISO file as a drive. (right click on the ISO file and select Mount)

For Windows 7 OS, either the ISO file has to be mounted as a drive or the ISO contents extracted to a folder using a 3rd party software tool. Software Tool providers (tools have not been tested and are not supported by the Kodak Alaris team, customers have reported that (7-zip, winrar, winiso) offer such capability.

Date:	September 11, 2017
CD Version:	2.26
Firmware	1.35 (separate file, not part of CD) for i1150/i1190
Firmware	1.32 (separate file, not part of CD) for i1180/i1190E
Twain:	14.6
Driver.dll:	4.9
Twaingui:	8.1
Hippo.dll:	52.35
Device.dll:	4.6
DeviceManager.dll:	1.20
ISIS driver:	1.1.11609.30001
Smart Touch App	No Longer on CD

Change Requests Implemented:

4. DIAS-1136 – Many changes to Automatic Rotation to support credit card scanning which are dark and have limited text printed on them.
5. DIAS-1225 – Remove SmartTouch from installation media
6. DIAS-1226 – Remove Capture Pro LE from installation media
7. DIAS-1284 – Update Installer with link to Smart Touch and Capture Pro LE internet downloadable files.

Driver Issues Fixed:

1. DIAS-1198 Address a Citrix connectivity issue
2. DIAS-1126-Address issue with Windows VM using USB Redirection

Firmware Issues Fixed:

2. None

Kodak i1100 Series Scanners Windows Drivers Release Notes

Known Issues:

3. PR 25176: CD 2.04 and higher will not install on “Server 2008-R2” and “Server 2012-R2”
 - a. Workaround
 - i. .NET Framework 3.5 or higher must be installed
 - ii. Desktop Experience must be installed
 - iii. Must be logged in as administrator
 - iv. Must right click on set_up.exe and use can install via Run as administrator

Version CD 2.16 Summary

Purpose of Release: This is a CPE release of drivers for the Kodak i1150 Scanner.

Note: When installing a Kodak i1150 Scanner on a host PC for the first time the Full Install CD (shipped with the scanner) must be used. If the InstallSoftware_v2.xx.exe driver installer is used for a new installation the Kodak Smart Touch application will not be installed. The InstallSoftware_v2.xx.exe may be used to update a host PC that used an Install CD Version 1.xx for its first install.

Date:	January 9, 2017
CD Version:	2.16
Firmware	1.35 (separate file, not part of CD) for i1150/i1190
Firmware	1.32 (separate file, not part of CD) for i1180/i1190E
Twain:	14.5
Driver.dll:	4.8
Twaingui:	8.1
Hippo.dll:	52.30
Device.dll:	4.4
DeviceManager.dll:	1.17
ISIS driver:	1.1.11609.30001
Smart Touch App	1.8.68.475

New Driver Features:

8. CR 5370 - Add QR Barcode reading
9. CR 5276 - Add 64-bit TWAIN driver
10. CR 5119 - Do not Install ISIS on Windows XP Operating System computers

Smart Touch Features/Fixes:

1. PR 26539 - When scanner wakes from sleep mode, it no longer connects
2. CPSOLSTS-101/202 - Smart Touch not sending paper source information
3. PR 26223 - When you set the searchable PDF of the i1190 SmartTouch it shows Arabic as an option
4. CPSOLSTS-163 - Folder permissions are being changed when users are scanning
5. CPSOLSTS-164 – SmartTouch won't install when a folder redirection of the users' home directories to a server has been moved
6. CPSOLSTS-166 - The date is being repeated in the filename string
7. CPSOLSTS-186 - SmartTouch upgrade does not always happen correctly when running silently

Driver Issues Fixed:

1. PR 26946 - i1150 when scanning 2D barcode with TWAIN or ISIS Driver

Kodak i1100 Series Scanners Windows Drivers Release Notes

2. PR 26840 - problem when scanning dark hard cards (credit cards)
3. PR 25842 - Unable to communicate with scanner after PC comes out of Sleep Mode
4. PR 25701 - When using Blank page removal, an image that is not blank is being deleted
5. DIAS-507- WIA version not updating with i11xx CD v2.14 upgrade [Smart Touch scanner buttons don't work, but Smart Touch in system tray works]
6. DIAS-889 - Smart Touch Buttons on OCP not functioning in Windows XP

Firmware Issues Fixed:

3. DIAS-478: Scanner errors on OCP can be over written on startup
4. CD 5390 - Increase the feeder clutch on time from 10mm to 20mm - also in FW 1.32

Known Issues:

4. PR 25176: CD 2.04 and higher will not install on "Server 2008-R2" and "Server 2012-R2"
 - a. Workaround
 - i. .NET Framework 3.5 or higher must be installed
 - ii. Desktop Experience must be installed
 - iii. Must be logged in as administrator
 - iv. Must right click on set_up.exe and use can install via Run as administrator

**Kodak i11xx Series Scanners Software Release Notes
Version CD 2.07.01 Summary**

Purpose of Release: This is a LPO release to the drivers for the Kodak i3000 scanners which allows the locking of a specific customer application to occur such that the TWAIN driver will only work with this one specific application.

Date: November 9, 2016
CD Version: 2.07.01

Kodak i1150 Scanner Software Release Notes**Version CD 2.07 Summary**

Purpose of Release: This is a CSM release of drivers for the Kodak i1150 Scanner.

Note: When installing a Kodak i1150 Scanner on a host PC for the first time the Full Install CD (shipped with the scanner) must be used. If the InstallSoftware_v2.xx.exe driver installer is used for a new installation the Kodak Smart Touch application will not be installed. The InstallSoftware_v2.xx.exe may be used to update a host PC that used an Install CD Version 1.xx for its first install.

Date: January 30th, 2016
CD Version: 2.07
Firmware 1.21
Twain: 14.2
Driver.dll: 4.3
Twaingui: 6.7
Hippo.dll: 52.26
Device.dll: 4.1
DeviceManager.dll: 1.14
ISIS driver: 1.1.11512.4001
Smart Touch App 1.8.43.247

New Driver Features:

11. Increase to 30ppm from 25ppm
12. Change to default profile: Turned off Hole fill and Streak Removal

Smart Touch Features

1. None

Issues Fixed:

7. None

Known Issues:

None

Version CD 2.01 Summary

Purpose of Release: This is a CSM release of drivers for the Kodak i1150 Scanner.

Note: When installing a Kodak i1150 Scanners on a host PC for the first time the Full Install CD (shipped with the scanner) must be used. If the InstallSoftware_v2.xx.exe driver installer is used for a new installation the Kodak Smart Touch application will not be installed. The InstallSoftware_v2.xx.exe may be used to update a host PC that used an Install CD Version 1.xx for its first install.

Date:	November 18, 2014
CD Version:	2.01
Firmware	1.04.02
Twain:	13.1
Driver.dll:	13.6
Twaingui:	5.36
Hippo.dll:	52.24
Device.dll:	4.2
DeviceManager.dll:	1.9
ISIS driver:	1.1.11404.29001
Smart Touch App	1.8.18.104

New Driver Features:

13. Add error message for no image data
14. Mac Drivers Available
15. Mac - PageManager - Scan Button was launched and added to the system tray
16. Add JPEG and G4 Compressions to PageManager
17. Expand Linux support to 64-bit for Ubuntu 14.04 (LTS)
18. Develop Mag Adjustment Tool Mag for China Bank customers

Smart Touch Features

1. Have a silent installer option for Smart Touch patch (web) installer
2. Ability to not create a copy of the file on the PC when emailing a document
3. Add the name WebDAV to Custom Cloud
4. Add 'create folder' icon to configure cloud storage screen
5. Support Scan to Google Drive (CloudStorage)
6. Hide 'delete file after sending' option when change to non-mail destination

Issues Fixed:

8. None

Known Issues:

None