

Kodak i1800 Series Scanners ISIS Driver Update Release Notes

ISIS Driver Version eki1860_ 2.0.11509.25001

Summary: This release was created to correct an issue with printing the time for seven days following the daylight savings time change.

Date: 9/25/2015

New Features from version 2.0.11112.14001:

1. (none)

Improvements from version 2.0.11112.14001:

1. PR24700 – Corrected a problem where the printed time stamp will be off by 1 hour for 7 days following the Daylight Savings Time change. This delayed time change will occur in years where the time change occurs on a month that starts with a Sunday. (2015/2020/2026/2037...).
2. Updated to the latest QuickDriver version 2.0.11508.19001 (from 1.0.10910.14001)
3. ISIS-38921: 'String not found' pops up with 'Cancel With Scanahead' testing in drvrttest
4. ISIS-38929: 'Tag_Scannermodel' testing failed in Drvrttest

ISIS Driver Version eki1860_2.0.11112.14001

Date: 12/14/2011

New Features from version 2.0.11005.27004:

1. (none)

Improvements from version 2.0.11005.27004:

1. PR#19340 - an Enable that fails due to no paper will not retain the seed Image Address for the next Enable.
2. IA-44184 - PixTools is expecting PIX_ERR_MULTIFEED (-4616) on multifeed error. Getting -4765. 4765 is an internal error code that was sufficient prior to PixTools .NET. This driver was modified to raise PIX_ERR_MULTIFEED error as expected by PixTools .NET. For applications that expect the legacy behavior (raising of -4765), the following entry can be made in the [LegacyMode] section of SETSCAN.INI:
[LegacyMode]
eki1860.MultifeedErrorCode=1